



Safety Data Sheet

SECTION 1: Identification

1.1. Product Identifier

Trade Name or Designation: Tungsten ICP Standard, 1000 ppm W in 2% HNO₃/1% HF

Product Number: PW1KN

Other Identifying Product Numbers: PW1KN-100, PW1KN-500

1.2. Recommended Use and Restrictions on Use

General Laboratory Reagent

1.3. Details of the Supplier of the Safety Data Sheet

Company: Ricca Chemical Company

Address: 448 West Fork Drive
Arlington, TX 76012 USA

Telephone: 888-467-4222

1.4. Emergency Telephone Number (24 hr)

CHEMTREC (USA) 800-424-9300
CHEMTREC (International) 1+ 703-527-3887

Safety Data Sheet

SECTION 2: Hazard(s) Identification

2.1. Classification of the Substance or Mixture (in accordance with OSHA HCS 29 CFR 1910.1200)

For the full text of the Hazard and Precautionary Statements listed below, see Section 16.

| Hazard Class | Category | Hazard Statement | Precautionary Statements |
|--|------------|------------------|---|
| Acute Toxicity - Oral | Category 3 | H301 | P264, P270, P301+P310, P321, P330, P405, P501 |
| Acute Toxicity - Dermal | Category 3 | H311 | P280, P302+P352, P312, P321, P361, P405, P501 |
| Acute Toxicity - Inhalation | Category 2 | H330 | P260, P271, P285, P304+P340, P310, P320, P403+P233, P405, P501 |
| Skin Corrosion / Irritation | Category 1 | H314 | P260, P264, P280, P301+P330+P331, P303+P361+P353, P363, P304+P340, P310, P321, P305+P351+P338, P405, P501 |
| Eye Damage / Irritation | Category 1 | H318 | P280, P305+P351+P338, P310 |
| Respiratory Sensitizer | Category 1 | H334 | P261, P285, P304+P341, P342+P311, P501 |
| Skin Sensitizer | Category 1 | H317 | P261, P272, P280, P302+P352, P332+P313, P321, P363, P501 |
| Specific Target Organs/Systemic Toxicity Following Single Exposure | Category 1 | H370 | P260, P264, P270, P307+P311, P321, P405, P501 |
| Specific Target Organs/Systemic Toxicity Following Repeated Exposure | Category 1 | H372 | P260, P264, P270, P314, P501 |
| Corrosive to Metals | Category 1 | H290 | P234, P390, P406 |

2.2. GHS Label Elements

Pictograms:



Signal Word: **Danger**



Safety Data Sheet

Hazard Statements:

| Hazard Number | Hazard Statement |
|---------------|--|
| H290 | May be corrosive to metals. |
| H301 | Toxic if swallowed. |
| H311 | Toxic in contact with skin. |
| H314 | Causes severe skin burns and eye damage. |
| H317 | May cause an allergic skin reaction. |
| H318 | Causes serious eye damage. |
| H330 | Fatal if inhaled. |
| H334 | May cause allergy or asthma symptoms or breathing difficulties if inhaled. |
| H370 | Causes damage to organs. |
| H372 | Causes damage to organs through prolonged or repeated exposure. |

Safety Data Sheet

Precautionary Statements:

| Precautionary Number | Precautionary Statement |
|----------------------|---|
| P234 | Keep only in original container. |
| P260 | Do not breathe dust, fumes or mist. |
| P261 | Avoid breathing dust, fumes or mist. |
| P264 | Wash arms, hands and face thoroughly after handling. |
| P270 | Do not eat, drink or smoke when using this product. |
| P271 | Use only outdoors or in a well-ventilated area. |
| P272 | Contaminated work clothing must not be allowed out of the workplace. |
| P280 | Wear protective gloves and eye protection. |
| P285 | In case of inadequate ventilation wear respiratory protection. |
| P301+P310 | IF SWALLOWED: Immediately call a POISON CENTER or physician. |
| P301+P330+P331 | IF SWALLOWED: rinse mouth. Do NOT induce vomiting. |
| P302+P352 | IF ON SKIN: Wash with plenty of soap and water. |
| P303+P361+P353 | IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. |
| P304+P340 | IF INHALED: Remove person to fresh air and keep comfortable for breathing. |
| P304+P341 | IF INHALED: If breathing is difficult, remove person to fresh air and keep comfortable for breathing. |
| P305+P351+P338 | IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to d Continue rinsing. |
| P307+P311 | IF exposed: Call a POISON CENTER or physician. |
| P310 | Immediately call a POISON CENTER or physician. |
| P312 | Call a POISON CENTER or physician if you feel unwell. |
| P314 | Get medical attention if you feel unwell. |
| P320 | Specific treatment is urgent (Wash areas of contact with water immediately). |
| P321 | Specific treatment (Wash areas of contact with water immediately). |
| P330 | Rinse mouth. |
| P332+P313 | If skin irritation occurs: Get medical attention. |
| P342+P311 | If experiencing respiratory symptoms: Call a POISON CENTER or physician. |
| P361 | Take off immediately all contaminated clothing and wash it before reuse. |
| P363 | Wash contaminated clothing before reuse. |
| P390 | Absorb spillage to prevent material damage. |
| P403+P233 | Store in a well-ventilated place. Keep container tightly closed. |
| P405 | Store locked up. |
| P406 | Store in corrosive resistant container with a resistant inner liner. |
| P501 | Dispose of contents in accordance with local, state, federal and international regulations. |



Safety Data Sheet

2.3. WHMIS Classification

WHMIS classification is not included based on the recommended option (Option 4) found in the Canada Gazette Part II, Vol. 149, No.3, page 458

2.4. Hazards not Otherwise Classified or Covered by GHS

Data not available.

SECTION 3: Composition / Information on Ingredients

3.1. Components of Substance or Mixture

| Chemical Name | Formula | Molecular Weight | CAS Number | Weight% |
|-------------------|------------------|------------------|------------|---------|
| Water | H ₂ O | 18.01 g/mol | 7732-18-5 | 96.72% |
| Nitric Acid | HNO ₃ | 63.01 g/mol | 7697-37-2 | 2.48% |
| Hydrofluoric Acid | HF | 20.00 g/mol | 7664-39-3 | 0.71% |
| Tungsten | W | 183.84 g/mol | 7440-33-7 | 0.10% |

SECTION 4: First-Aid Measures

4.1. General First Aid Information

Eye Contact: IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. May cause irritation, redness, pain, and tearing.

Inhalation: IF INHALED: If breathing is difficult, remove person to fresh air and keep comfortable for breathing.

Skin Contact: IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. May cause irritation, redness and pain. Contact will discolor skin yellow-brown depending on exposure which will wear off after a period of time.

Ingestion: IF SWALLOWED: rinse mouth. Do NOT induce vomiting. Dilute with water or milk. Do not induce vomiting. Call a physician if necessary.

4.2. Most Important Symptoms and Effects, Acute and Delayed

Corrosive Liquid. Avoid contact with skin, eyes, and clothing. Avoid breathing vapor. If swallowed, do not induce vomiting. Dilute with water and call a physician. Wash areas of contact with plenty of water. Some of the Hydrofluoric Acid is used up in the reaction to dissolve the metal. EYE CONTACT: May cause irritation, redness, pain, and tearing. SKIN CONTACT: May cause irritation, redness and pain. Contact will discolor skin yellow-brown depending on exposure which will wear off after a period of time.

4.3. Medical Attention or Special Treatment Needed

Immediately call a POISON CENTER or physician. Specific treatment is urgent (Wash areas of contact with water immediately). Specific treatment (Wash areas of contact with water immediately).



Safety Data Sheet

SECTION 5: Fire-Fighting Measures

5.1. Extinguishing Media

Use any means suitable for extinguishing surrounding fire.

5.2. Specific Hazards Arising from the Substance or Mixture

Not combustible, but substance is an oxidizer and its heat of reaction with reducing agents or combustibles may cause ignition. Can react with metals to release flammable hydrogen gas.

5.3. Special Protective Equipment for Firefighters

Use protective clothing and breathing equipment appropriate for the surrounding fire.

SECTION 6: Accidental Release Measures

6.1. Personal Precautions, Protective Equipment and Emergency Procedures

Wear protective gloves and eye protection. In case of inadequate ventilation wear respiratory protection.

6.2. Cleanup and Containment Methods and Materials

Absorb with suitable material and dispose of in accordance with local regulations.

SECTION 7: Handling and Storage

7.1. Precautions for Safe Handling and Storage Conditions

Store in corrosive resistant container with a resistant inner liner. As with all chemicals, wash hands thoroughly after handling. Avoid contact with eyes and skin. Protect from freezing and physical damage.

Safety Data Sheet

SECTION 8: Exposure Controls / Personal Protection

8.1. Control Parameters

| Chemical Name | Limit Type | Country | Exposure Limit | Information Source |
|-------------------------------|-------------|---------|--|--|
| Hydrofluoric Acid (7664-39-3) | TWA | USA | 2.5 mg/m ³ TWA (as F) 2.5 mg/m ³ TWA (dust) | U.S. - OSHA - Final PELs - Time Weighted Averages (TWAs) |
| Hydrofluoric Acid (7664-39-3) | TWA | USA | 3 ppm TWA (as F) | U.S. - OSHA - Final PELs - Time Weighted Averages (TWAs) |
| Hydrofluoric Acid (7664-39-3) | TLV-Ceiling | USA | 2 ppm Ceiling (as F) | ACGIH - Threshold Limit Values - Ceilings (TLV-C) |
| Hydrofluoric Acid (7664-39-3) | TLV-TWA | USA | 0.5 ppm TWA (as F) | ACGIH - Threshold Limit Values - Time Weighted Averages (TLV-TWA) |
| Hydrofluoric Acid (7664-39-3) | TLV-TWA | USA | 2.5 mg/m ³ TWA (as F) | ACGIH - Threshold Limit Values - Time Weighted Averages (TLV-TWA) |
| Nitric Acid (7697-37-2) | TWA | USA | 2 ppm TWA 5 mg/m ³ TWA | U.S. - OSHA - Final PELs - Time Weighted Averages (TWAs) |
| Nitric Acid (7697-37-2) | TLV-STEL | USA | 4 ppm STEL | ACGIH - Threshold Limit Values - Short Term Exposure Limits (TLV-STEL) |
| Nitric Acid (7697-37-2) | TLV-TWA | USA | 2 ppm TWA | ACGIH - Threshold Limit Values - Time Weighted Averages (TLV-TWA) |
| Tungsten (7440-33-7) | TLV-STEL | USA | 10 mg/m ³ STEL | ACGIH - Threshold Limit Values - Short Term Exposure Limits (TLV-STEL) |
| Tungsten (7440-33-7) | TLV-STEL | USA | 10 mg/m ³ STEL (as W) | ACGIH - Threshold Limit Values - Short Term Exposure Limits (TLV-STEL) |
| Tungsten (7440-33-7) | TLV-TWA | USA | 5 mg/m ³ TWA (as W) | ACGIH - Threshold Limit Values - Time Weighted Averages (TLV-TWA) |
| Tungsten (7440-33-7) | TLV-TWA | USA | 5 mg/m ³ TWA | ACGIH - Threshold Limit Values - Time Weighted Averages (TLV-TWA) |

8.2. Exposure Controls

Engineering Controls: Use only outdoors or in a well-ventilated area. No specific controls are needed. Normal room ventilation is adequate.

Respiratory Protection: In case of inadequate ventilation wear respiratory protection. Normal room ventilation is adequate.

Skin Protection: Wear protective gloves and eye protection. Chemical resistant gloves.

Eye Protection: Wear protective gloves and eye protection. Safety glasses or goggles.

8.3. Personal Protective Equipment

Wear protective gloves and eye protection. In case of inadequate ventilation wear respiratory protection. Normal room ventilation is adequate. Chemical resistant gloves. Safety glasses or goggles.



Safety Data Sheet

SECTION 9: Physical and Chemical Properties

9.1. Basic Physical and Chemical Properties

Appearance: Colorless liquid

Physical State: Liquid

Odor: Data not available.

Odor Threshold: Data not available.

pH: Data not available.

Melting/Freezing Point: Data not available.

Initial Boiling Point /Range: Approximately 100°C - Approximately 100°C

Flash Point: Data not available.

Evaporation Rate: Data not available.

Flammability: Data not available.

Flammability/Explosive Limits: Data not available.

Vapor Pressure: Data not available.

Vapor Density: Data not available.

Relative Density: 1.02

Solubility: Miscible

Partition Coefficient (n-Octanol/Water): Data not available.

Auto-Ignition Temperature: Data not available.

Decomposition Temperature: Data not available.

Viscosity: Data not available.

Explosive Properties: Data not available.

Oxidizing Properties: Data not available.

SECTION 10: Stability and Reactivity

10.1. Reactivity and Chemical Stability

Stable under normal conditions of use and storage.

10.2. Possibility of Hazardous Reactions

Data not available.

10.3. Conditions to Avoid and Incompatible Materials

Keep only in original container. Strong bases, metallic powders.

10.4. Hazardous Decomposition Products

Will not occur.



Safety Data Sheet

SECTION 11: Toxicological Information

11.1. Information on Toxicological Effects

Acute Toxicity - Oral Exposure:

Toxic if swallowed. Wash arms, hands and face thoroughly after handling. Do not eat, drink or smoke when using this product. IF SWALLOWED: Immediately call a POISON CENTER or physician. Specific treatment (Wash areas of contact with water immediately). Rinse mouth. Store locked up. Dispose of contents in accordance with local, state, federal and international regulations.

Acute Toxicity - Dermal Exposure:

Toxic in contact with skin. Wear protective gloves and eye protection. IF ON SKIN: Wash with plenty of soap and water. Call a POISON CENTER or physician if you feel unwell. Specific treatment (Wash areas of contact with water immediately). Take off immediately all contaminated clothing and wash it before reuse. Store locked up. Dispose of contents in accordance with local, state, federal and international regulations.

Acute Toxicity - Inhalation Exposure:

Fatal if inhaled. Do not breathe dust, fumes or mist. Use only outdoors or in a well-ventilated area. In case of inadequate ventilation wear respiratory protection. IF INHALED: Remove person to fresh air and keep comfortable for breathing. Immediately call a POISON CENTER or physician. Specific treatment is urgent (Wash areas of contact with water immediately). Store in a well-ventilated place. Keep container tightly closed. Store locked up. Dispose of contents in accordance with local, state, federal and international regulations.

Acute Toxicity - Other Information:

LDLo, Oral, Human: 430 mg/kg (Nitric Acid), details of toxic effects not reported other than lethal dose value.

Skin Corrosion and Irritation:

Causes severe skin burns and eye damage. Do not breathe dust, fumes or mist. Wash arms, hands and face thoroughly after handling. Wear protective gloves and eye protection. IF SWALLOWED: rinse mouth. Do NOT induce vomiting. IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. Wash contaminated clothing before reuse. IF INHALED: Remove person to fresh air and keep comfortable for breathing. Immediately call a POISON CENTER or physician. Specific treatment (Wash areas of contact with water immediately). IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Store locked up. Dispose of contents in accordance with local, state, federal and international regulations.

Serious Eye Damage and Irritation:

Causes serious eye damage. Wear protective gloves and eye protection. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Immediately call a POISON CENTER or physician.

Respiratory Sensitization:

May cause allergy or asthma symptoms or breathing difficulties if inhaled. Avoid breathing dust, fumes or mist. In case of inadequate ventilation wear respiratory protection. IF INHALED: If breathing is difficult, remove person to fresh air and keep comfortable for breathing. If experiencing respiratory symptoms: Call a POISON CENTER or physician. Dispose of contents in accordance with local, state, federal and international regulations.

Skin Sensitization:

May cause an allergic skin reaction. Avoid breathing dust, fumes or mist. Contaminated work clothing must not be allowed out of the workplace. Wear protective gloves and eye protection. IF ON SKIN: Wash with plenty of soap and water. If skin irritation occurs: Get medical attention. Specific treatment (Wash areas of contact with water immediately). Wash contaminated clothing before reuse. Dispose of contents in accordance with local, state, federal and international regulations.



Safety Data Sheet

Germ Cell Mutagenicity:

Not applicable.

Carcinogenicity:

Not applicable.

Reproductive Toxicity:

Not applicable.

Specific Target Organ Toxicity from Single Exposure:

Causes damage to organs. Do not breathe dust, fumes or mist. Wash arms, hands and face thoroughly after handling. Do not eat, drink or smoke when using this product. IF exposed: Call a POISON CENTER or physician. Specific treatment (Wash areas of contact with water immediately). Store locked up. Dispose of contents in accordance with local, state, federal and international regulations.

Specific Target Organ Toxicity from Repeated Exposure:

Causes damage to organs through prolonged or repeated exposure. Do not breathe dust, fumes or mist. Wash arms, hands and face thoroughly after handling. Do not eat, drink or smoke when using this product. Get medical attention if you feel unwell. Dispose of contents in accordance with local, state, federal and international regulations.

Aspiration Hazard:

Not applicable.

Additional Toxicology Information:

Data not available.

SECTION 12: Ecological Information

12.1. Ecotoxicity

Not applicable.

12.2. Persistence and Degradability

Data not available.

12.3. Bioaccumulative Potential

Data not available.

12.4. Mobility in Soil

Data not available.

12.5. Other Adverse Ecological Effects

Data not available.

SECTION 13: Disposal Considerations

13.1. Waste Treatment Methods

Data not available.



Safety Data Sheet

SECTION 14: Transportation Information

14.1. Transportation by Land - Department of Transportation (DOT, United States of America)

UN Number: UN3264

Proper Shipping Name: Corrosive Liquid, Acidic, Inorganic, n.o.s., (Nitric Acid and Hydrofluoric Acid)

Hazard Class: 8

Packing Group: III

Hazard Placard Labels:



14.2. Transportation by Air - International Air Transport Association (IATA)

UN Number: UN3264

Proper Shipping Name: Corrosive Liquid, Acidic, Inorganic, n.o.s., (Nitric Acid and Hydrofluoric Acid)

Hazard Class: 8

Packing Group: III

Hazard Placard Labels:



SECTION 15: Regulatory Information

15.1. Occupational Safety and Health Administration (OSHA) Hazards

Not listed.

15.2. Superfund Amendments and Reauthorization Act (SARA) 302 Extremely Hazardous Substances

Hydrofluoric Acid (CAS # 7664-39-3): 100 lb EPCRA RQ

Hydrofluoric Acid (CAS # 7664-39-3): 100 lb TPQ

Nitric Acid (CAS # 7697-37-2): 1000 lb EPCRA RQ

Nitric Acid (CAS # 7697-37-2): 1000 lb TPQ

15.3. Superfund Amendments and Reauthorization Act (SARA) 311/312 Hazardous Chemicals

Tungsten (CAS # 7440-33-7): 10 curie final RQ; 0.37 TBq final RQ

Tungsten (CAS # 7440-33-7): 100 curie final RQ; 3.7 TBq final RQ

Tungsten (CAS # 7440-33-7): 1000 curie final RQ; 37 TBq final RQ

Hydrofluoric Acid (CAS # 7664-39-3): 100 lb final RQ; 45.4 kg final RQ

Nitric Acid (CAS # 7697-37-2): 1000 lb final RQ; 454 kg final RQ



Safety Data Sheet

15.4. Superfund Amendments and Reauthorization Act (SARA) 313 Toxic Release Inventory (TRI)

Hydrofluoric Acid (CAS # 7664-39-3): 1.0 % de minimis concentration

Nitric Acid (CAS # 7697-37-2): 1.0 % de minimis concentration

15.5. Massachusetts Right-to-Know Substance List

Tungsten (CAS # 7440-33-7): Present

Hydrofluoric Acid (CAS # 7664-39-3): Extraordinarily hazardous

Nitric Acid (CAS # 7697-37-2): Extraordinarily hazardous

15.6. Pennsylvania Right-to-Know Hazardous Substances

Tungsten (CAS # 7440-33-7): Present

Hydrofluoric Acid (CAS # 7664-39-3): Environmental hazard

Hydrofluoric Acid (CAS # 7664-39-3): Present

Hydrofluoric Acid (CAS # 7664-39-3): Present (dust)

Nitric Acid (CAS # 7697-37-2): Environmental hazard

Nitric Acid (CAS # 7697-37-2): Present

Water (CAS # 7732-18-5): Present

15.7. New Jersey Worker and Community Right-to-Know Components

Tungsten (CAS # 7440-33-7): flammable - third degree

Tungsten (CAS # 7440-33-7): sn 1959

Hydrofluoric Acid (CAS # 7664-39-3): corrosive

Hydrofluoric Acid (CAS # 7664-39-3): sn 0936

Hydrofluoric Acid (CAS # 7664-39-3): sn 3759

Hydrofluoric Acid (CAS # 7664-39-3): SN 3759 TPQ: 100 lb; SN 1014 TPQ: 500 lb (Hydrogen fluoride gas only, NJ uses UN1052 for reporting purposes)

Nitric Acid (CAS # 7697-37-2): corrosive; reactive - second degree

Nitric Acid (CAS # 7697-37-2): sn 1356

Nitric Acid (CAS # 7697-37-2): SN 1356 TPQ: 500 lb

Nitric Acid (CAS # 7697-37-2): sn 3722

Nitric Acid (CAS # 7697-37-2): SN 3722 TPQ: 500 lb (water dissociable, Category Code N511)

15.8. California Proposition 65

Not listed.

15.9. Canada Domestic Substances List / Non-Domestic Substances List (DSL/NDSL)

Tungsten (CAS # 7440-33-7): Present

Hydrofluoric Acid (CAS # 7664-39-3): Present

Nitric Acid (CAS # 7697-37-2): Present

Water (CAS # 7732-18-5): Present



Safety Data Sheet

15.10. United States of America Toxic Substances Control Act (TSCA) List

Tungsten (CAS # 7440-33-7): Present

Hydrofluoric Acid (CAS # 7664-39-3): Present [T]

Nitric Acid (CAS # 7697-37-2): Present

Water (CAS # 7732-18-5): Present

15.11. European Inventory of Existing Commercial Chemical Substances (EINECS), European List of Notified Chemical Substances (ELINCS), and No Longer Polymers (NLP)

Not listed.

SECTION 16: Other Information

16.1. Full Text of Hazard Statements and Precautionary Statements

May be corrosive to metals. Toxic if swallowed. Toxic in contact with skin. Causes severe skin burns and eye damage. May cause an allergic skin reaction. Causes serious eye damage. Fatal if inhaled. May cause allergy or asthma symptoms or breathing difficulties if inhaled. Causes damage to organs. Causes damage to organs through prolonged or repeated exposure.

Keep only in original container. Do not breathe dust, fumes or mist. Wash arms, hands and face thoroughly after handling. Do not eat, drink or smoke when using this product. Use only outdoors or in a well-ventilated area. Contaminated work clothing must not be allowed out of the workplace. Wear protective gloves and eye protection. In case of inadequate ventilation wear respiratory protection.

IF SWALLOWED: Immediately call a POISON CENTER or physician. IF ON SKIN: Wash with plenty of soap and water. IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. IF INHALED: Remove person to fresh air and keep comfortable for breathing. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. IF exposed: Call a POISON CENTER or physician. Get medical attention if you feel unwell. Specific treatment is urgent (Wash areas of contact with water immediately). If skin irritation occurs: Get medical attention. If experiencing respiratory symptoms: Call a POISON CENTER or physician. Wash contaminated clothing before reuse. Absorb spillage to prevent material damage.

Store in a well-ventilated place. Keep container tightly closed. Store locked up. Store in corrosive resistant container with a resistant inner liner.

Dispose of contents in accordance with local, state, federal and international regulations.

16.2. Miscellaneous Hazard Classes

Canadian Carcinogenicity Hazard Class: Not Applicable.

Physical Hazards Not Otherwise Classified (PHNOC): Not Applicable.

Health Hazards Not Otherwise Classified (HHNOC): Not Applicable.


Not Applicable.



Safety Data Sheet

16.3. National Fire Protection Association (NFPA) Rating

Health: 2
Flammability: 0
Reactivity: 0
Special Hazard:

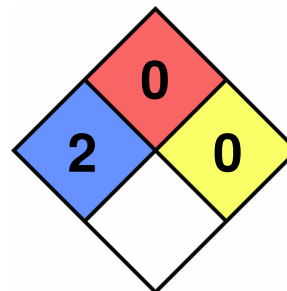



Safety Data Sheet

16.4. Document Revision

Last Revision Date: 5/1/2015

DISCLAIMER

When handled properly by qualified personnel, the product described herein does not present a significant health or safety hazard. Alteration of its characteristics by concentration, evaporation, addition of other substances, or other means may present hazards not specifically addressed herein and which must be evaluated by the user. The information furnished herein is believed to be accurate and represents the best data currently available to us. No warranty, expressed or implied, is made and RICCA CHEMICAL COMPANY assumes no legal responsibility or liability whatsoever resulting from its use.